

Date: 07/10/2025
Author: Robert Lutje
Distribution: Partners

DC 8600
 SN-DC8600_002_MS-Driver_EN

New Windows Driver Version V 2.127.0.0

A new **Driver V2.127.0.0** for the **DC-8600** is available. This driver includes several improvements and bug fixes compared to previous versions.

The driver **must** be used with the **Firmware version 40.00.00.23** and higher. To take advantage of these features, the DC-8600 printer must have firmware version 40.00.00.23 or higher installed.

So, it is mandatory to use the driver V2.127.0.0 and firmware version 40.00.00.23 or higher revision release together!

- To start the Windows driver installation, click on the **DC8600-x86_64-Windows-Driver-V2.127.0.0.exe** (Yellow marked) and follow the instructions.

DC8600-x86_64-Windows-Driver-V2.127....	10.09.2025 08:34	Anwendung	37.593 KB
Readme	11.09.2025 16:19	Textdokument	3 KB
Setup	10.09.2025 08:25	Windows-Batchda...	8 KB

- The new printer driver version also supports **Silent Installation**. A detailed installation description can be found in the **Readme file** in the driver folder (Blue marked).
- A **new Uninstaller** is also available and allow a **complete removal** of the driver in the Windows registry.

There is also the possibility to uninstall the driver via the installation program, but this routine will **not remove all the information** from the Windows registry!

The uninstaller can be found under c:\programms\DC8600-x86_64-Windows-Driver-V2.127.0.0

Driver	11.09.2025 08:25	Dateiordner	
DriverWizard	01.07.2025 16:12	Anwendung	495 KB
unins000.dat	11.09.2025 08:25	KMPlayer64.dat	25 KB
unins000	11.09.2025 08:25	Anwendung	3.505 KB
Uninstall	11.09.2025 08:26	Windows-Batchdatei	2 KB

		UCL from - to -	Page 1 of 3
Company / Factory: General Information	Subsidiary: General Information	Customer: General Information	
			www.dascom.com


Date: 07/10/2025
Author: Robert Lutje
Distribution: Partners

DC 8600
 SN-DC8600_002_MS-Driver_EN

New Windows Driver Version V 2.127.0.0

The following changes and improvements are available with this driver version:

- Network behavior improved, only **standard port 9100** is used in the network for printing and administration.
- Improvement of **Ribbon Synchronization**
- Easier and simplified **Tray selection** and **Tray Linking**
- Improved **Twice Transfer Printing** (Increase of card life time - borderless)

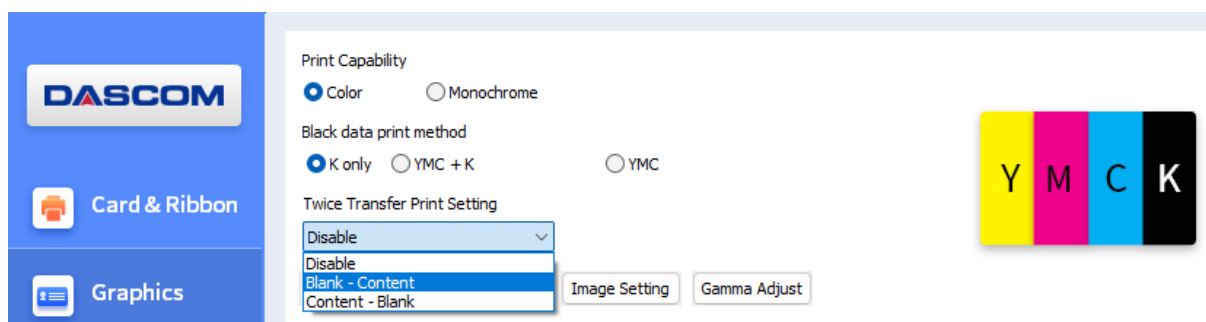

- If the printer is connected to an **Enterprise Network** a message will pop up when the "Search" button is used during the network installation process for IP address detection. This behavior is caused by firewall settings and under this condition the **IP address** of printer must be **entered manually**.
- **Improved Temperature Management** and control of the heater fan, available in the **Service Mode** with the following options:
 - AUTO =>** The fan runs during printing and switches off approximately 5 seconds after the print job ends.
This is the recommended setting and is set by default.
 - OFF =>** The fan only runs when the printer overheats (Only to be used for small individual print jobs).
 - ON =>** The fan runs continuously


		UCL from - to -	Page 2 of 3
Company / Factory: General Information	Subsidiary: General Information	Customer: General Information	
			www.dascom.com

Date: 07/10/2025
Author: Robert Lutje
Distribution: Partners

DC 8600
 SN-DC8600_002_MS-Driver_EN

New Windows Driver Version V 2.127.0.0

- **Enhanced color management** available default setting AdobeRGB

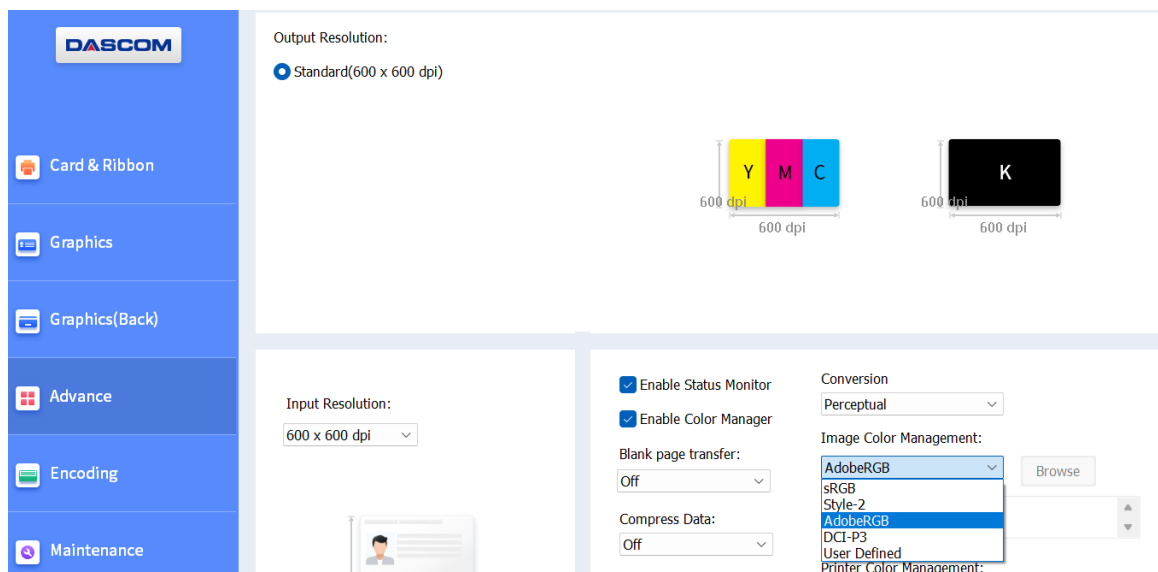

We recommend to upgrade DC-8600 printers with lower driver and firmware releases.

		UCL from - to -	Page 3 of 3
Company / Factory: General Information	Subsidiary: General Information		Customer: General Information
			www.dascom.com